

# JOB ASSIGNMENT & COMPLETION REPORT

















**Prepared by** Jason Budd

**Date**November 15th 2021

Site Ref 13160

Site Name St Peters Church - 13160 + CHESHIRE,



Ref # 1.2

#### 1. HEALTH & SAFETY & HYGIENE Ref Name Answer Comments 1.1 Confirm that you have reviewed and accepted Yes Standard RAMS (and 'specific' RAMS such as 'working the RAMS (including any 'specific' or 'special' with a cherry picker') are commonly applicable to our AS RAMS) for this activity? If NOT, you must STOP and do that before continuing. If 'special' RAMS have been created for this JOB, please check the 'internal notes' on your APP and you must review these 'special' RAMS for the work required before you start work. Each member of a 'TEAM JOB' must do this. If you believe the standard, specific or special RAMS are not appropriate or sufficient for this site, you must comment here and review your safety in continuing this If you answer YES to this question, you are confirming your RAMS are sufficient, complete and you have reviewed them, understand them and will comply with them. If you have any observations regarding the No catch board on bottom of pendulum box Yes 1.2 RAMS and H&S&H on this site, please take Customer has been made aware and will look into photo's and add comments... getting one fitted 15 Nov 2021 11:14 15 Nov 2021 11:15


Ref # 1.2

Ref # 1.2

#### 2. Photo Of Progress And/Or Completed JOB Ref Name Answer Comments 2.1 Take progress photographs. (and at the end of Yes On arrival on site the clock was running although each day, if the JOB is over multiple days) disconnected from dial works as left by previous engineer We tested the dial works and they appeared to run quite smoothly with only a very small amount of friction both from the dial bar and at the face itself (turning the hands) The hands came off relatively easily, however when it came to withdraw the dial works we found we had to dismantle the central section of the clock With the weights lowered to a safe position we took the central section out of the cage clock Then we could remove the dial works Our findings are as follows There is a large split along the full length of the hour The minute spindle is heavily corroded at the hand end and was difficult to withdraw from the hour tube. Once removed from the hour pipe, it couldn't be put back due to the amount of corrosion. The dial bar itself had a roller bearing instead of a brass bush, this itself has corroded and doesn't spin freely (replace with brass bush) The bush in the dial face appears to be in good condition, it will require cleaning and greasing on our return visit. The aperture through the wall that the dial works are fed out to the dial was filled with dust and nesting material. So much so that once the dial works we're out it was impossible to put them back through the dial. This has subsequently been cleared out ready for our return visit. The customer has been shown our findings and is aware that we have taken the dial works and hands off site to be returned to Derby works for assessment and repairs Also of note is the condition of the dial and frame surround The dial has suffered from the weather and the paint is starting to discolour and flake, the gold on the dial itself appears to be it good condition for its age. The frame around the dial is Oak and has rotted away on the bottom right of the dial, also on the bottom of the dial. The lead flashing on top of the dial is in good condition, but some of the mortar holding it in place has started to come out. (SEE PHOTOS) A full take down and restore in the workshop would be required to get this dial back to its best, something I haven't discussed with the customer. All tools, materials and rubbish were removed from site at the end of the day.





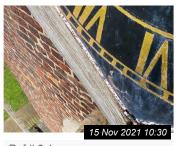



Ref # 2.1

Ref # 2.1

# 2. Photo Of Progress And/Or Completed JOB (Cont.)









Ref # 2.1

Ref # 2.1

Ref # 2.1

Ref # 2.1









Ref # 2.1

Ref # 2.1

Ref # 2.1

Ref # 2.1









Ref # 2.1

Ref # 2.1

Ref # 2.1

Ref # 2.1









Ref # 2.1

Ref # 2.1

Ref # 2.1

Ref # 2.1









Ref # 2.1

Ref # 2.1

Ref # 2.1

Ref # 2.1

# 2. Photo Of Progress And/Or Completed JOB (Cont.)



Ref # 2.1



Ref # 2.1



Ref # 2.1



Ref # 2.1



Ref # 2.1



Ref # 2.1



Ref # 2.1



Ref # 2.1



Ref # 2.1



Ref # 2.1



Ref # 2.1



Ref # 2.1



Ref # 2.1



Ref # 2.1



Ref # 2.1



Ref # 2.1



Ref # 2.1



Ref # 2.1



Ref # 2.1



Ref # 2.1

# 2. Photo Of Progress And/Or Completed JOB (Cont.)









Ref # 2.1

Ref # 2.1

Ref # 2.1

Ref # 2.1



Ref # 2.1

# 3. JOB COMPLETE - CMR TO ADD?

Ref	Name	Answer	Comments
3.1	If you have identified a CMR opportunity on this JOB, tell us more here with great photo's:		

# 4. Job Completion/Signatures

Ref	Name	Answer	Comments
4.1	If possible, acquire a completion signature from the customer/client representative		

### Declaration

The work has been completed to my satisfaction.

Signed by the			
Signature			
Print Name			
Date	/	/	

St Peters Church - 13160 + CHESHIRE, Swettenham, CW12 2LF

Signed by the			
Signature			
Print Name			
Date	/	/	

# **Terms and Conditions**

To review the current Terms & Conditions of Smith of Derby Limited, please review these on the company website at www.smithofderby.com