



Existing chancel arch screen

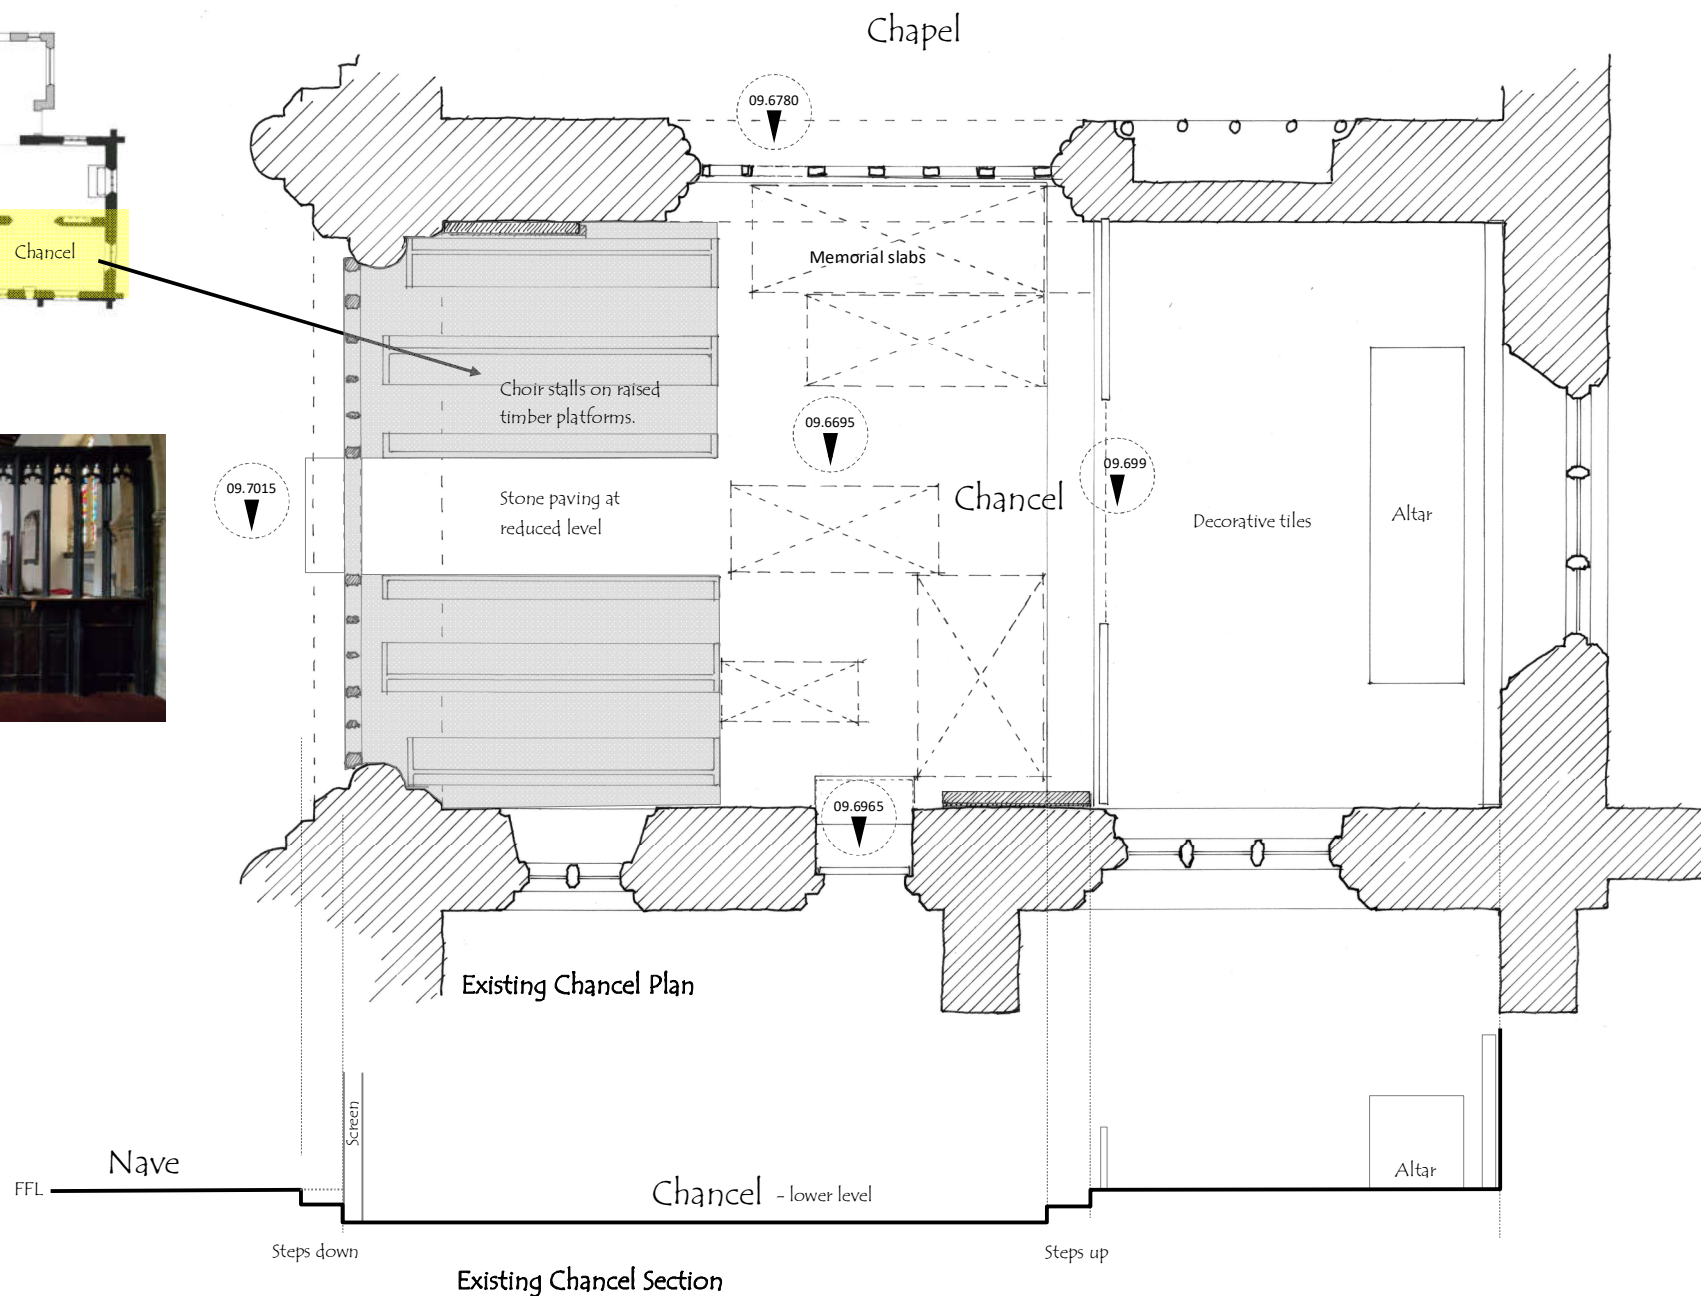

Priority Heritage Historic Buildings Consultants

Sharnbrook Church - Internal Access Improvements

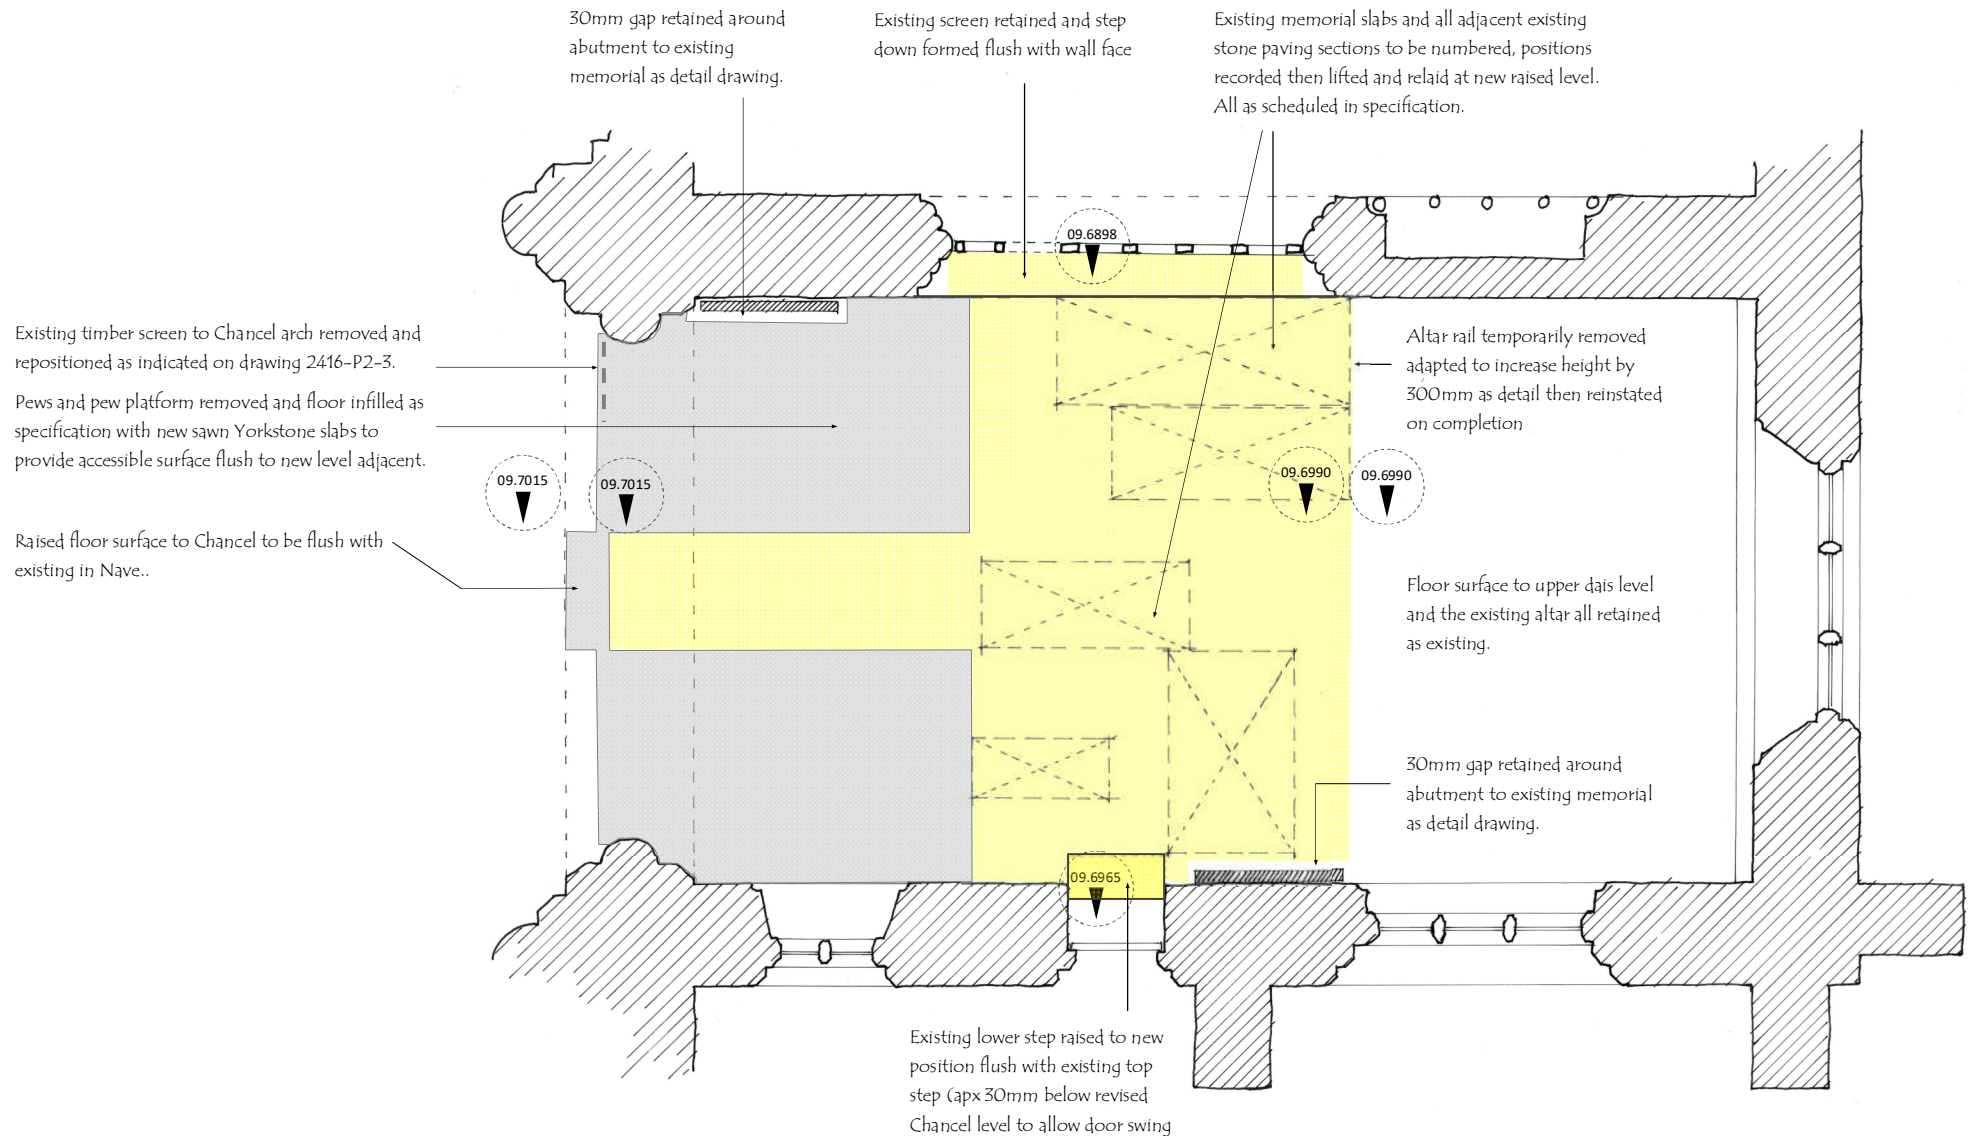


Proposed Chancel Plan




Priory Heritage Historic Buildings Consultants

Shambrook Church - Internal Access Improvements

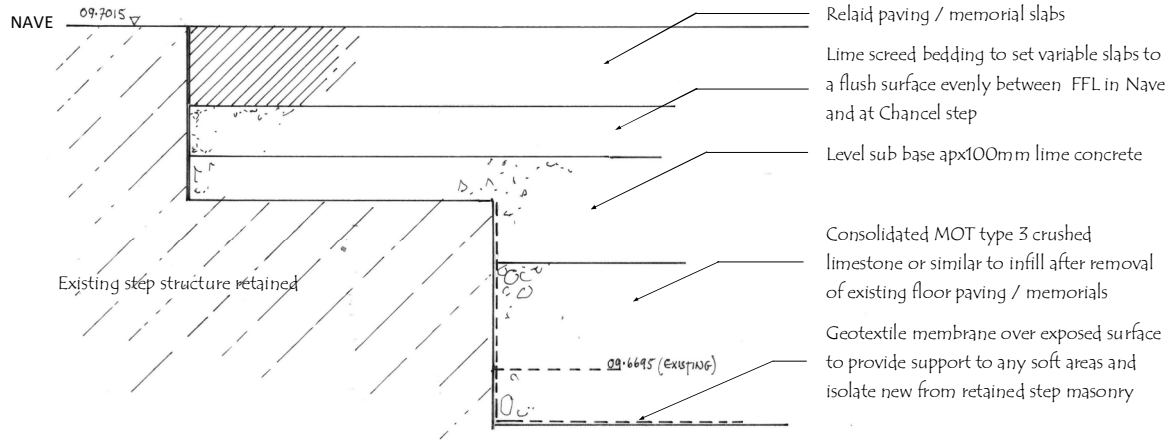


Floor Detail A

45mm stone perimeter rebated to support 25mm thick oak infill. Drilled 2N° 20mm holes to vent gap and allow infill strip to be removed to inspect monument + clear void.

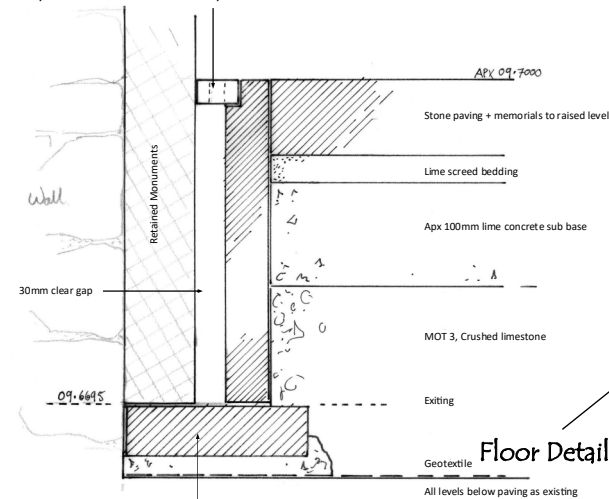


Floor Detail B

Rebed new section stone slab at original level to support monument and form base of vent gap structure






Proposed Chancel Plan

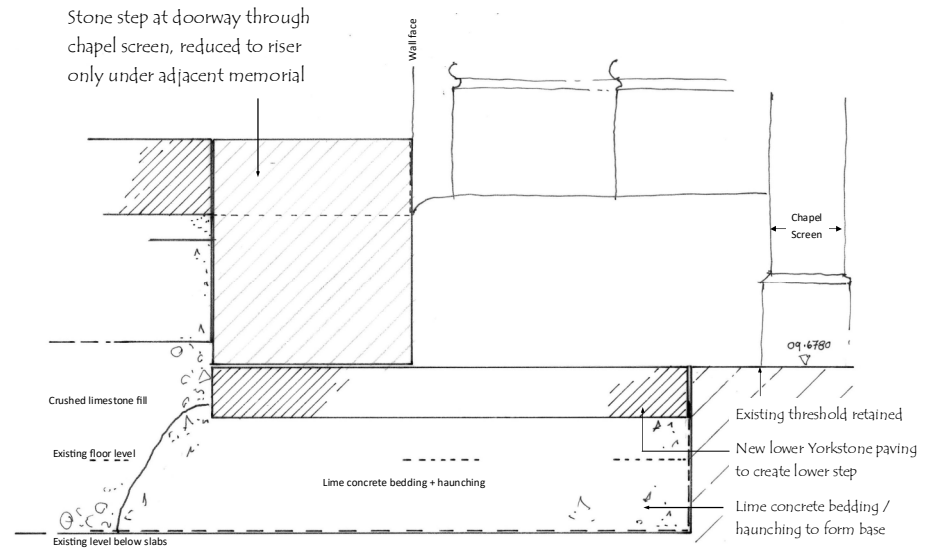

Floor Detail C

Floor Detail D

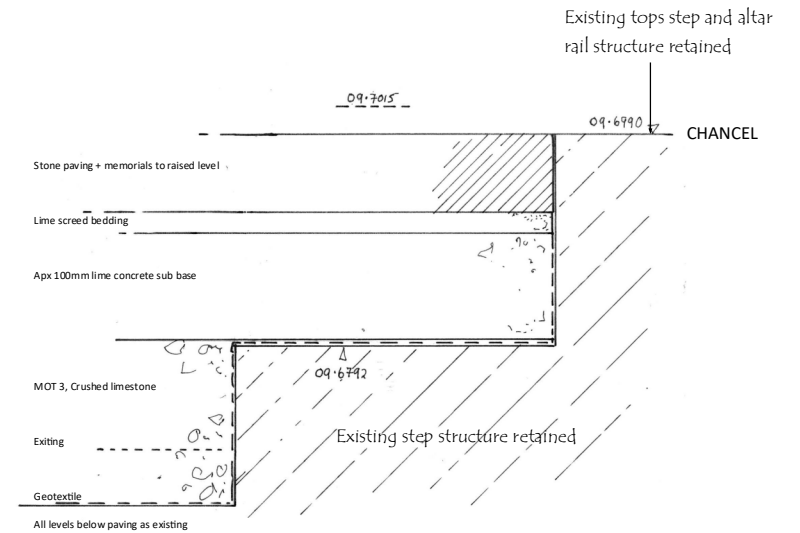

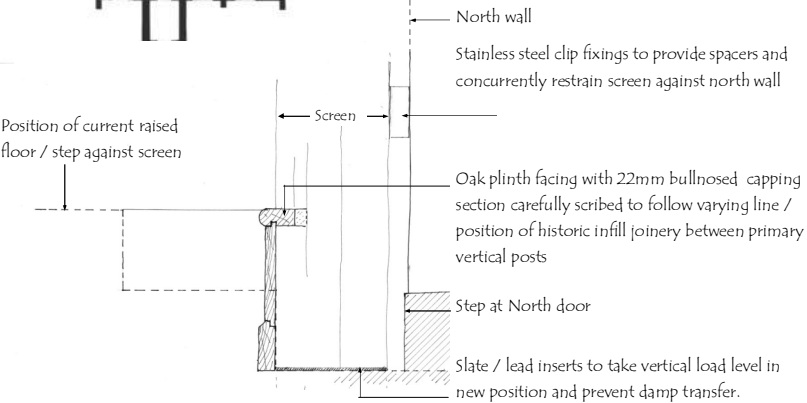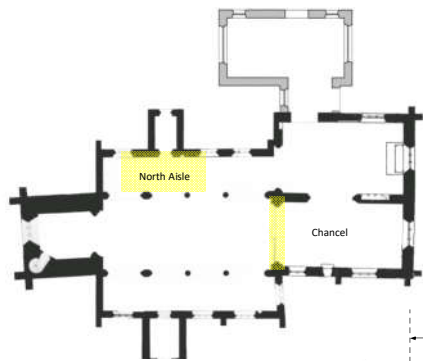


Nominal post profile, varies to each post + different heights




Plinth Facing detail


Purpose made stainless steel restraint clip to retain against wall, Exact fixing positions agreed with C.A. on site to limit visibility

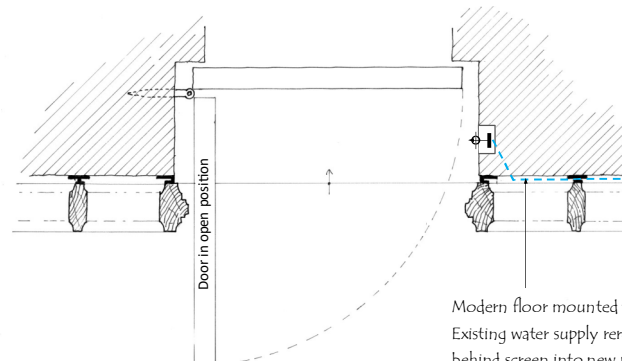

North Door - screen detail

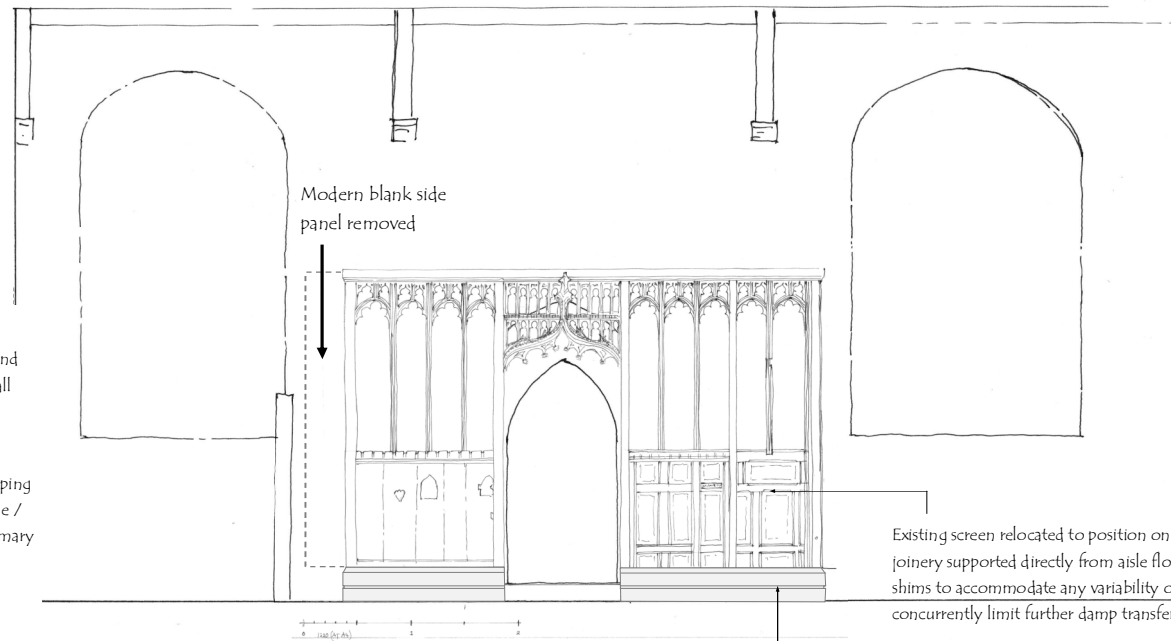

North Aisle Elevation

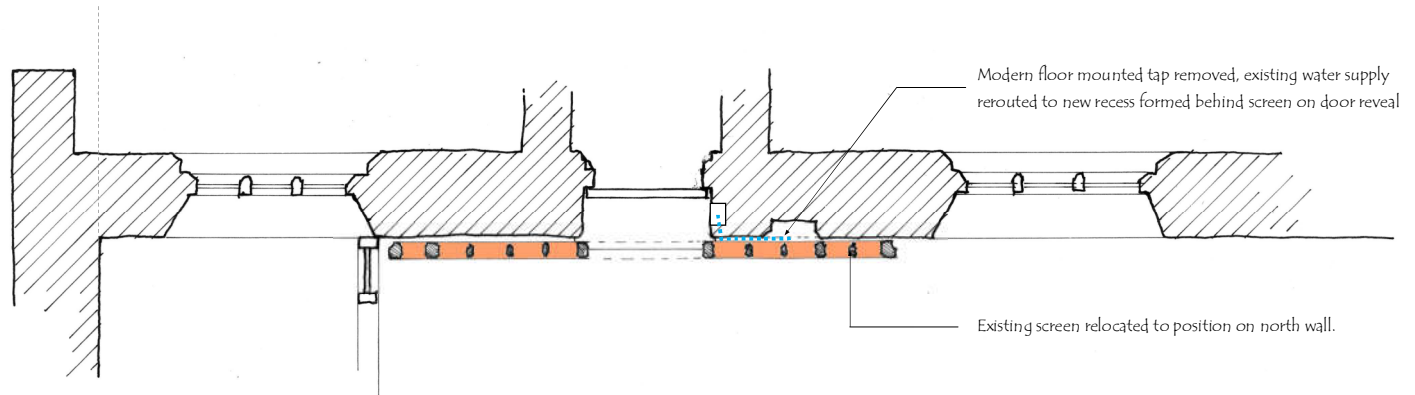

North Aisle Plan



Priory Heritage Historic Buildings Consultants

Sharnbrook Church - Internal Access Improvements

DRG-2416-P2-4a



Photo-montage of screen in revised position

---

Priory Heritage Historic Buildings Consultants

Sharnbrook Church - Internal Access Improvements